
AIP MALAYSIA
AD 2-WMKA-2-3
16 JUL 2024

## AIRCRAFT PARKING/ DOCKING CHART - ICAO

APRON ELEV 5 M TWR 122.30 SMC 121.60 ATIS 128.65 TRAINING 129.10

## ALOR SETAR/SULTAN ABDUL HALIM AIRPORT

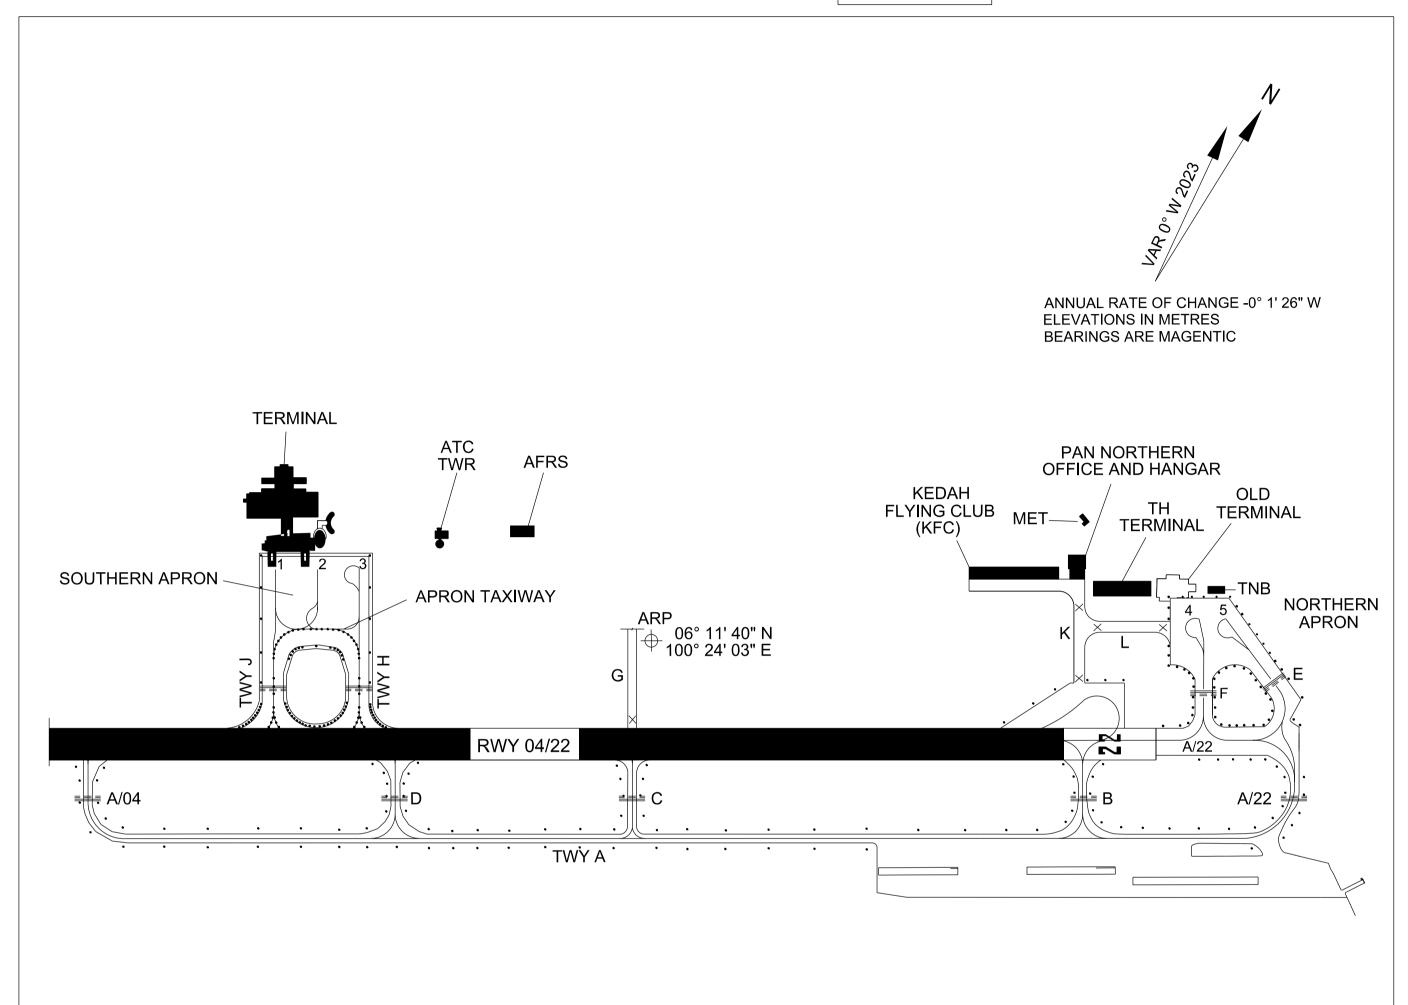

TAXIWAYS A, B, C AND D 15 M WIDE
TAXIWAYS E, F, H AND J 23 M WIDE
APRON TAXIWAY (SOUTHERN APRON) 23 M WIDE


BEARING STRENGTH TWY A, A/04, A/22, B, C AND D PCN 37/F/C/W/T BEARING STRENGTH TWY E AND F PCN 100/R/C/W/T BEARING STRENGTH TWY H AND J PCN 96/F/C/X/T BEARING STRENGTH APRON TAXIWAY (SOUTHERN APRON) PCN 96/R/C/X/T

TAXIWAY EDGE LIGHTS ON A, B, C, D, E, F, H AND J TAXIWAY CENTRELINE LIGHTS ON H AND J

AIRCRAFT STANDS 1 AND 2 APGS EQUIPPED

## **AIRCRAFT PARKING/DOCKING STAND POSITION**

INS COORDINATES FOR AIRCRAFT STANDS		SURFACE & STRENGTH	AIRCRAFT TYPE		
SOUTHERN APRON					
1	06° 11' 27.73" N	100° 23' 45.48" E	PCN 75/R/C/X/T	B738, A320, A21N	
2	06° 11' 29.36" N	100° 23' 46.96" E	PCN 75/R/C/X/T	A333, B738, A320, A21N	
3	06° 11' 30.79" N	100° 23' 48.45" E	PCN 75/R/C/X/T	AT75, AT76	
NORTHERN APRON					
4	06° 12' 03.64" N	100° 24' 22.42" E	PCN 100/R/C/W/T	B738	
5	06° 12' 04.64" N	100° 24' 23.90" E	PCN 100/R/C/W/T	B738	

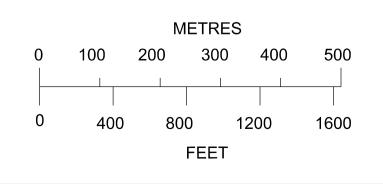

LEGEND	
AIRCRAFT STAND	5
TAXIWAY LIGHT	•
RUNWAY-HOLDING POSITION	
CLOSED MARKING	X

CHANGES: ADD INFORMATION TWY G, K AND L
CHANGE INFORMATION COORDINATES FOR BAY 4 AND 5
CHANGE INFORMATION AIRCRAFT STANDS AT NORTHERN APRON